

ⓘ This is a sample report. Some items may not be applicable to all assets and photos may vary to other reports.

Pre-purchase inspection report

Date completed: 23/03/2020

Vehicle Information

BMW S 1000 R Sport



VIN

JN1TANT31A000302R

Model Year

2017

Engine Number

52WVC10338

Build Date

10 / 2017

Odometer Reading

5200

Compliance date

12 / 2017


Registration Number

MYBIKE

Registration Expiry

11 / 2020

Report Summary

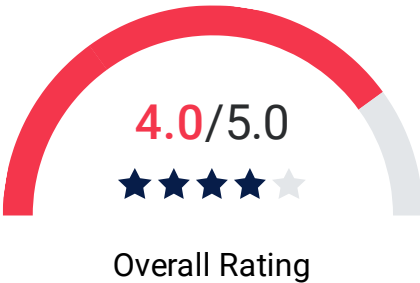

Chassis
★★★★★ 3.5
[View more](#)

Body & Controls
★★★★★ 5.0
[View more](#)

Engine & Gearbox
★★★★★ 3.5
[View more](#)

Tyres, Wheels & Brakes
★★★★★ 5.0
[View more](#)

Stationary Test

“The vehicle presents in good overall condition with the only issues found being a weak battery. After a road test the battery was performing much better, recommend giving the battery a full charge and retesting. Other than that the vehicle had no major issues cosmetically or mechanically.



Ray McGuire
Inspector



Attention Required

Transmission Housing

★★☆☆☆ 2.0

Clutch feels excessively heavy at the level: further investigation needed.

Final / Shaft Drive

★★☆☆☆ 2.0

Chain or drive belt guard missing from vehicle, unroadworthy: investigate further

Battery

★★☆☆☆ 2.0

Battery discharged on initial start up, slow to crank engine: further investigation needed.

Gearbox

★★☆☆☆ 2.0

Operational noise(s)/free play detected, further investigation/repairs required.

Rear Suspension Operation

★★☆☆☆ 2.0

Operational noise(s)/free play detected, further investigation and/ or repairs required.

Timing Chain / Cam Belt

★★☆☆☆ 2.0

Moderate noise to the camshaft/drivebelt area consistent with wear or poor adjustment: investigate further.

Owners Manual & Service Intervals

★★☆☆☆ 2.0


Services not documented into the booklet, no history present. Some owners manuals present: investigate further.

Visual Details







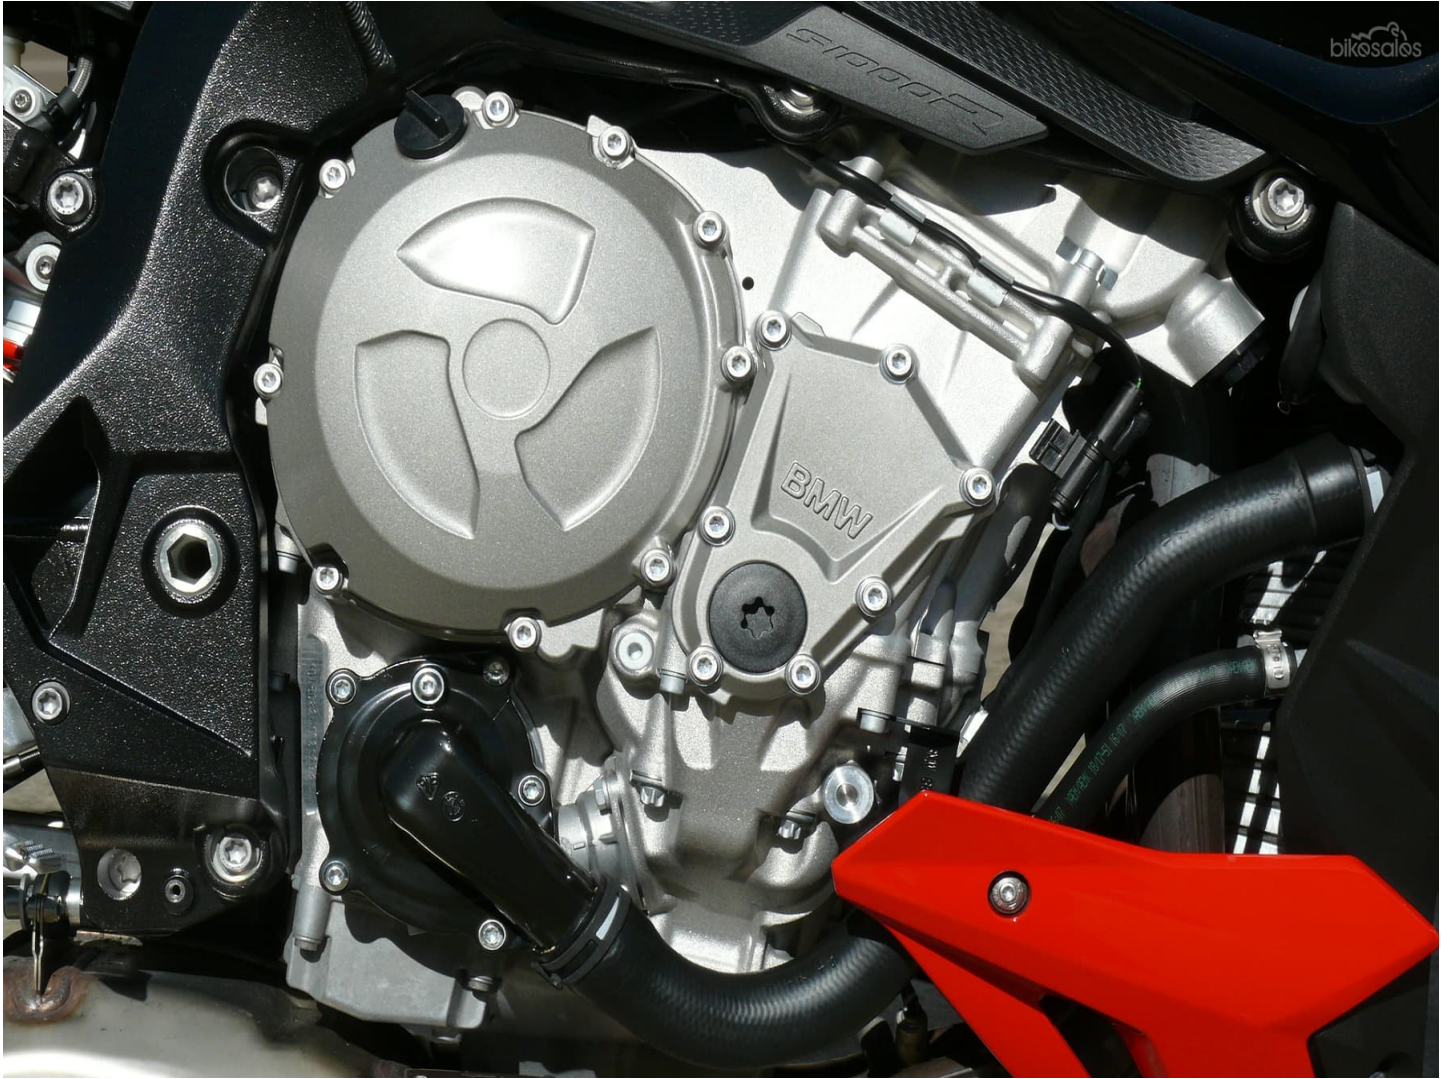



Full Report

Select category to view results

Chassis (★ 3.5) 

Chassis ★ 3.5

Frames & Members

★★★★★ 5.0

Frame and members are in good working order at the time of inspection.

Rust & Corrosion

★★★☆☆ 3.0

Surface rust visible to various underbody and engine bay components: further investigation recommended. The scope of the inspection does not include removal of components, only what is visible at the time. Paintwork and various components may inhibit detection of rust and corrosion

Stands

Not Applicable

Front Suspension

★★★☆☆ 3.0

Normal wear (ageing) and light surface corrosion to the front suspension components consistent with the age and mileage.

Rear Suspension

★★★★★ 5.0

Rear suspension is in good working order and condition at the time of inspection.

Steering Components

★★★★★ 5.0

Fork Condition

★★★★☆ 4.0

Superficial wear and marks to the fork sliders and triple trees consistent with the age and mileage

Transmission Housing

★★☆☆☆ 2.0

Clutch feels excessively heavy at the level: further investigation needed.

Sprockets

★★★☆☆ 3.0

Working OK at the time of inspection. Normal wear and tear evident to the sprocket components consistent with the age and mileage.

Belt / Chain Condition

Not Applicable

Final / Shaft Drive

★★☆☆☆ 2.0

Chain or drive belt guard missing from vehicle, unroadworthy: investigate further

Body & Controls ★ 5.0

Seats

★★★★★ 5.0

Custom Seat: In good working order and condition at the time of inspection.

Other Trims

★★★★★ 5.0

Plastic trims in as new visual condition

Foot Pegs

★★★★☆ 4.0

Aftermarket foot pegs or rear sets fitted, check for compliance, could affect roadworthiness: investigate further

Cables & Hydraulic Lines

★★★★★ 5.0

All visible cables and hydraulic lines in good visual condition and working order at the time of inspection

Steering Dampener

★★★★☆ 4.0

Superficial wear evident to the steering dampener and components consistent with the age and mileage.

Horn

★★★★★ 5.0

In good working order and condition at the time of inspection.

Handle Bars & Mountings

★★★★★ 5.0

Handle bars and mountings in good working order and condition at the time of inspection

Handle Bar Controls

★★★★★ 5.0

Handle bar controls in good working order and condition at the time of inspection

Gear, Clutch & Brake Levers

★★★★★ 5.0

Gear, clutch and brake levers in good working order and condition at the time of inspection

Radio

★★★★★ 5.0

Stereo system fitted, handlebar audio controls, and navigation, all power up at the time

All Lights

★★★★★ 5.0

All lights in good working order at the time of the inspection

Glass & Mirrors

★★★★★ 5.0

In good working order and condition at the time of inspection.

Front & Rear Guards

★★★★★ 5.0

Front and rear guards in good working order and condition at the time of inspection

Fairing & Body Repairs

★★★★☆ 4.0

Aftermarket body panels or accessories fitted, encourage buyer to inspect prior to purchase. Accessories appear in good visual condition for the age and mileage

Chrome & Alloy Condition

★★★★★ 5.0

Chrome and/ or alloy in good visual condition, no signs of any visual and obvious defects at the time

Under Body Components

★★★★★ 5.0

Underbody components (underside of the lower fairing or cowling) in good working order at the time of inspection.

Exhaust

★★★★★ 5.0

Exhaust system is in good working order and condition at the time of inspection.

Dash Warning Lights & Gauges

★★★★★ 5.0

No abnormal warning lights on in the dash cluster, all gauges appear to be in good working order, dashboard and trims in good visual condition.

Locks & Hinges

★★★★★ 5.0

key/s sighted and tested. Locks and hinges in good working order at the time of inspection.

Engine & Gearbox ★ 3.5

Noise

★★★★★ 4.0

Engine warm/hot on initial start up, cold start not tested. No abnormal noises from the engine bay at the time of testing.

Fluid Level

★★★★★ 3.0

All visible fluid levels within specifications however some discolouration detected, service or repairs may be required

Fluid Leaks

★★★★★ 4.0

No visible fluid leaks from the engine, gearbox or underneath the machine at the time of inspection. Restricted visibility due to engine top covers and lower trays fitted (if applicable), not removed during this inspection.

Mountings

★★★★★ 5.0

In good working order and condition at the time of inspection.

Hoses & Pipes

★★★★★ 3.0

General wear and tear evident to the hoses, pipes and components consistent with the age and mileage.

Water Pump & Cooling Fan

★★★★★ 3.0

Working OK at the time of inspection. General wear to the water pump, cooling fan and components consistent with the age and mileage.

Cooling Fins

★★★★★ 3.0

General wear and visible aging to the cooling fins and components consistent with age and mileage. OK at time of inspection.

Battery



Battery discharged on initial start up, slow to crank engine: further investigation needed.

Fuel System



Working OK at the time of inspection. General wear evident to the fuel system components consistent with the age and mileage.

Ignition System



Working well at the time of inspection. Normal wear evident to the ignition system components consistent with the age and mileage.

Radiator & Cap



General wear and visible aging to the cooling system components consistent with age and mileage. OK at time of inspection.

Tyres, Wheels & Brakes ★ 5.0

Wheel Rims & Spoke Condition

★★★★★ 5.0

Front and rear wheel rims were in good working order and visible condition at the time of inspection.

Brake Master Cylinder / ABS

★★★★★ 5.0

In good working order at the time of inspection.

Brake Hose Callipers & Pipes

★★★★★ 5.0

Brake callipers, hoses and pipes are in good working order and condition at the time of inspection.

Brake Pads

★★★★★ 5.0

OK at time of inspection (the scope of the inspection is limited to an approximate and what is visible at the time).

Brake Discs

★★★★★ 5.0

Front and rear brake discs are in good working order and condition at the time of inspection. Brake disc thickness not measured during this inspection

Brake Linings

Not Applicable

Brake Drums

Not Applicable

Park Brake

★★★★★ 5.0

Park brake is in good working order and condition at the time of inspection.

Wheel Bearings

★★★★★ 5.0

Wheel bearings appear to be in good working order and condition at the time of inspection.

Tyres

★★★★★ 5.0

Front and rear tyres are in good working order and have approx.

Stationary Test ★ 3.0

Ease of Starting & Idle

★★★★★ 5.0

Engine started from cold: OK at time of testing

Engine Noise

★★★☆☆ 3.0

Normal operational noise to the engine typical of the age and mileage.

Exhaust Smoke & Emissions

★★★☆☆ 3.0

Some minor smoke emitted on start up, could be normal for this model: further investigation required.

Gearbox

★★☆☆☆ 2.0

Operational noise(s)/free play detected, further investigation/repairs required.

Front Suspension & Steering Operation

★★★☆☆ 3.0

Normal operational noise(s)/minor free play detected, consistent with age and mileage displayed.

Rear Suspension Operation

★★☆☆☆ 2.0

Operational noise(s)/free play detected, further investigation and/ or repairs required.

Timing Chain / Cam Belt

★★☆☆☆ 2.0

Moderate noise to the camshaft/drivebelt area consistent with wear or poor adjustment: investigate further.

Owners Manual & Service Intervals

★★☆☆☆ 2.0

Service not documented into the booklet or history report. Some owners manuals require investigation further.

Rating guide

★ 4.5 ~ 5.0 Very good

Item found to be in working order and/or no obvious signs of damage/degradation, consistent with age of vehicle.

★ 3.5 ~ 4.0 Good

Item found to be in working order with some signs of damage and/or wear & tear, consistent with age of vehicle.

★ 2.5 ~ 3.0 Fair

Item found to be in working order with some signs of damage and/or wear & tear, consistent with age of vehicle.

★ 1.5 ~ 2.0 Poor

Item found not to be in working order and/or major signs of damage and/or wear & tear.

★ 0.5 ~ 1.0 Very poor

Item found not to be in working order and/or major signs of damage and/or wear & tear.

Disclaimer

(a) The inspection is VISUAL and non-mechanical only and RedBook Inspect will not be responsible for any defects that are latent discovered which were not visually apparent during the inspection. The inspection will cover the vehicle's exterior, interior, engine compartment, tyres and wheels, brakes, under body and a road test where possible. The inspection will specifically not cover the items set out below. No removal of parts or components is undertaken during the inspection process. You acknowledge that while RedBook Inspect's inspectors use accepted methods for fault detection, these methods will not necessarily identify all faults with a vehicle. You should consider the age and condition of the vehicle at the time of inspection and any Report should be reviewed in this context. Vehicles are only road tested to speed limit of local area.

(b) The Report provided by RedBook Inspect to you is only current as at the time it is issued. It is a buyer's responsibility to conduct a visual inspection of the vehicle at the point of sale as RedBook Inspect can only advise on the condition of the vehicle at the time of inspection. The Report is not a roadworthy certificate and cannot be used as a roadworthy. You acknowledge that RedBook Inspect does not check for any manufacturer recall notices and you should check that the vehicle is not subject to a recall notice.

(c) RedBook Inspect will not be responsible for the terms of any transaction between any persons in relation to any vehicle inspected by RedBook Inspect or for resolving any dispute between any persons regarding any transaction.

(d) Subject to all applicable laws, RedBook Inspect does not provide any guarantee, warranty or representation regarding the nature, reliability, accuracy or completeness of any information contained in the Report or the fitness of the information contained in the Report for any purpose intended by you. To the full extent permitted by the law, RedBook Inspect will only be liable to you: (i) pursuant to any guarantee, right or contractual term that arises, is created or is implied by operation of law and that cannot be excluded PROVIDED THAT to the full extent permitted by law, any such liability of RedBook Inspect is limited, at RedBook Inspect's option, to (A) replacing or repairing the relevant goods (B) supplying goods equivalent to the relevant goods (C) supplying the relevant services again; or (D) paying the cost of such replacement, repairs or supply, subject always to subclause (g) below; or (ii) if Your claim arises from or in connection with any deliberate breach of these terms and conditions or fraud by RedBook Inspect.

(e) Except to the extent that liability cannot be excluded, RedBook Inspect, will not be liable to you for claims arising out of or in connection with your access and use of the this Report whether arising in contract, tort (including negligence), indemnity, strict liability, breach of warranty or statute.

(f) To the full extent permitted by law, RedBook Inspect will not be liable to you for loss of use, production, profit, revenue, business, data, contractor anticipated savings or for delay or for any financing costs or increase in operating costs or any economic loss for any indirect or consequential loss or damage.

(g) Your use of this Inspection Report is subject to the RedBook Inspect Service Terms available at <https://www.redbookinspect.com.au/terms-of-service>.